



No.: 07 TS-60
November 19, 2007

TO: Service Locations, Global Dealers

FROM: Technical Support Development

SUBJECT: **EPA07 MBE 4000 Code SPN 615/FMI 14 - Turbocharger Boost System Performance**

ISSUE

Detroit Diesel has identified a high incidence of Low Boost complaints with fault code 615/14 (Turbo boost performance) on the MBE 4000 engine due to the installation of an incorrect VPOD.

REQUIRED ACTION

Verify the correct VPOD part number. Correct P/N for EPA07 is A0001531259. Please check for the correct part number (see Figure 1). Valves labeled A0001530959 are NOT acceptable for use on 2007 models.



Figure 1 – VPOD Part Number Location

ADDITIONAL INFORMATION/NOTES

This information is applicable for engines produced prior to S/N 460906894.

In future software releases, the 615/14 turbo boost code has been reassigned to SPN 2631/FMI 2.

CONTACT INFORMATION

Please contact the Detroit Diesel Customer Support Center at 313-592-5800 or email csc@detroitdiesel.com if you have any questions.