

# Installation and Operation of the 518PH and 518APH TATTLETALE®

518-92178N  
Revised 02-01  
Section 25  
(00-02-0187)

**MURPHY**

Please read the following information before installing. A visual inspection of this product for damage during shipping is recommended before mounting. It is your responsibility to have a qualified person install this unit.

## GENERAL INFORMATION

### WARNING

BEFORE BEGINNING INSTALLATION OF THIS MURPHY PRODUCT

- ✓ Disconnect all electrical power to the machine.
- ✓ Make sure the machine cannot operate during installation.
- ✓ Follow all safety warnings of the machine manufacturer.
- ✓ Read and follow all installation instructions.

### Specifications

Case: Polycarbonate

Contact Rating: 10 A

Coil Circuit Resistance: 339 ohms  $\pm$  10% 12 Volt

678 ohms  $\pm$  10% 24 Volt

Minimum Latch Voltage: 12 Volt model: 10 VDC


24 Volt model: 20 VDC

Minimum Latch Current: 12 Volt model: 30 mA

24 Volt model: 30 mA



Operating Temperature Range: -40 to 176°F (-40 to 80°C)

### Dimensions and Installation

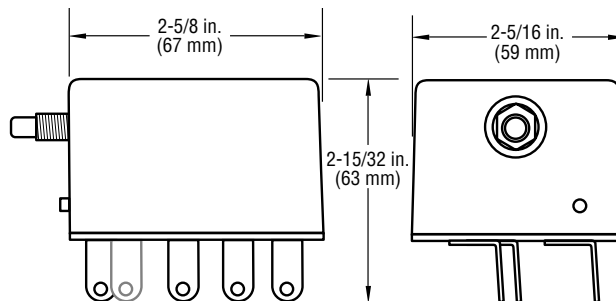


### Installation

#### Mounting Holes

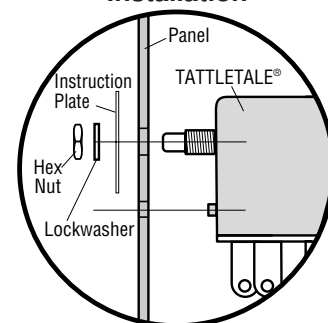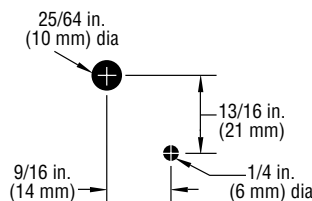


**CAUTION:** Certain dangers to human safety and to equipment may occur if some equipment is stopped without pre-warning. It is recommended that monitored functions be limited to alarm only or to alarm before shutdown.

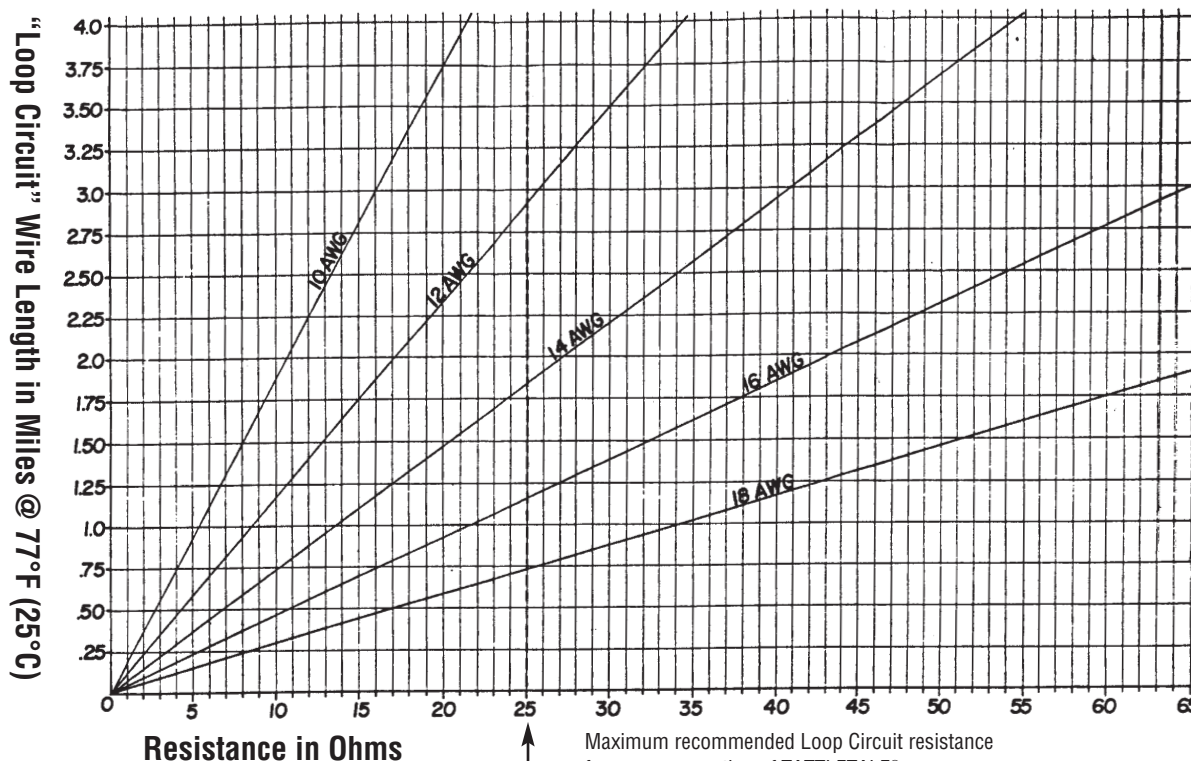

## TYPICAL WIRING DIAGRAMS

**Figure 1** shows a jumper installed between “SW1 and “SW2”. SWICHGAGE® instruments are normally open. This is not a Closed Loop™ circuit.

**Figure 1**

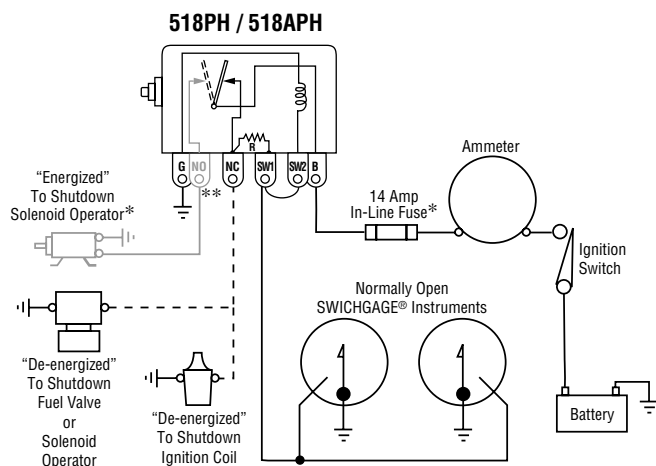


\* In-Line Fuse should be removed on “energized” to shutdown configurations.

\*\* Applies to 518APH model.

**Figure 2** shows a Closed Loop™ circuit with normally open Murphy SWICHGAGE® instruments and Normally Closed switches (alignment and “V” belt switches, etc.).

**Figure 2**

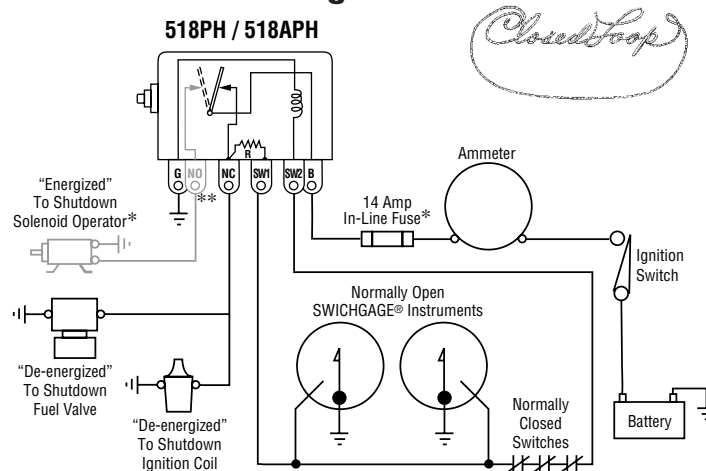

\* In-Line Fuse should be removed on “energized” to shutdown configurations.

\*\* Applies to 518APH model.

## TROUBLESHOOTING

**Push button will not remain in the depressed position after engine startup (wired according to Figure 2).**

- Be sure oil pressure is adequate to raise pointer past SWICHGAGE® contact. (Not necessary if oil pressure SWICHGAGE® is equipped with push button lockout.)
- Visually check wiring for loose connections, frayed wiring, etc. on all terminals and within switch loop circuit.
- Check 14 amp fuse connected to “B” terminal.
- Check for good ground on “G” terminal.
- Disconnect switch loop circuit from “SW1” and “SW2” terminals. Place a temporary jumper between SW1 and SW2 and restart engine. If the push button stays in with engine running, the 518PH/518APH is not the problem. This indicates either an open circuit, unwanted ground, or too high resistance in switch loop circuit wiring between “SW1” and “SW2”.
- Verify continuity by performing the following:
  1. Disconnect switch loop circuit from “SW1” and “SW2” terminals.
  2. Remove power from “B” terminal.
  3. Use an ohmmeter to check for “good continuity” (25 ohms or less) through **switch loop circuit**. If good continuity is indicated, proceed to Step 4.
  4. Adjust SWICHGAGE® contact away from pointer. Check continuity between one end of loop circuit, “SW1 or “SW2” and ground. Good

continuity (25 ohms or less) indicates an unwanted ground in loop circuit such as a terminal rotating against the mounting panel. Remove ground, restore loop circuit connections to “SW1” and “SW2”.

5. Reconnect power to “B” terminal and restart engine.
6. Using an ohmmeter, check resistance between one end of the loop circuit to the other. Resistance should not exceed 25 ohms. If resistance is too high, check for loose connections in loop circuit. Otherwise select larger size wire for loop circuit.

**Engine fails to shutdown when contacts close on one-wire to ground SWICHGAGE® controls (wired according to Figure 1).**

With engine running, jumper “SW1” to “G” terminal. If switch trips and engine shuts down, trouble could be SWICHGAGE® contacts not making contact, lack of good case ground on SWICHGAGE®, or broken/cut wire.

**Lack of case ground on SWICHGAGE®.**

Verify that mounting bracket on the SWICHGAGE® has broken through the panel paint and has made good contact with bare metal. If good contact has not been made, tighten mounting stud nuts accordingly.

**Failure of contacts on SWICHGAGE® to make contact.**

Adjust contacts back and forth against the pointer to give a wiping and cleaning action on contacts. If this does not correct the problem, replace SWICHGAGE®.

**MURPHY®**

FW Murphy  
P.O. Box 470248  
Tulsa, Oklahoma 74147 USA  
+1 918 317 4100  
fax +1 918 317 4266  
e-mail sales@fwmurphy.com  
www.fwmurphy.com

CONTROL SYSTEMS & SERVICES DIVISION  
P.O. Box 1819; Rosenberg, Texas 77471; USA  
+1 281 633 4500 fax +1 281 633 4588  
e-mail sales@fwmurphy.com

MURPHY DE MEXICO, S.A. DE C.V.  
Blvd. Antonio Rocha Cordero 300, Fracción del Aguaje  
San Luis Potosí, S.L.P.; México 78384  
+52 444 8206264 fax +52 444 8206336  
Villahermosa Office +52 993 3162117  
e-mail ventas@murphymex.com.mx  
www.murphymex.com.mx

FRANK W. MURPHY, LTD.  
Church Rd.; Laverstock, Salisbury SP1 1QZ; U.K.  
+44 1722 410055 fax +44 1722 410088  
e-mail sales@fwmurphy.co.uk  
www.fwmurphy.co.uk

MURPHY SWITCH OF CALIFORNIA  
41343 12th Street West  
Palmdale, California 93551-1442; USA  
+1 661 272 4700 fax +1 661 947 7570  
e-mail sales@murphyswitch.com  
www.murphyswitch.com

MACQUARRIE CORPORATION  
1620 Hume Highway  
Campbellfield, Vic 3061; Australia  
+61 3 9358 5555 fax +61 3 9358 5558  
e-mail murphy@macquarrie.com.au

